

---

**Date Code 031703**

**Correction**

- 1) Fixed problem which caused address data received with PCL commands from Windows programs (e.g., WORD) not to print in Inverted orientation.
- 
- 

**Date Code 021103**

**Corrections**

- 1) Fixed another problem, which caused the feeder to stop while the transport motor kept running (more addresses to print).
  - 2) Set battery reset default value for Feed Gap to "Stream Feeding".
  - 3) Improved transport motor control algorithm to provide smoother correction to belt speed when a load is applied and then removed.
- 
- 

**Date Code 011703**

**Correction**

- 1) Contains fix to set default "BANK A TO SENSOR" distance to 0.8 inches when NVRAM parameters are reset.
- 
- 

**Date Code 011603**

**Correction**

- 1) Contains fixes slow down and even out printing of purge and alignment patterns:
    - a. Run transport motor at 90% speed.
    - b. Run feeder motor at the same speed (as transport motor).
- 
- 

**Date Code 011503**

**Corrections**

- 1) Decreased transport speed in Executive print quality to prevent over driving of print heads.
  - 2) Fixed two problems, which caused the feeder to stop while the transport motor kept running (more addresses to print).
- 
-

### **Date Code 010903**

#### **Corrections**

- 1) Increased torque delivered by transport and feeder motors.

#### **Enhancements**

- 1) Added capability to print font character set by pressing TEST button while viewing the name of a Font in the MAIN / Font / FONT NAME sub-menu.
- 
- 

### **Date Code 010203**

Initial release.